

Name of the Engineer: Raju-G Date: 03/07/2021 Time: 2:30pm Place: Miyapur, Hyd.

WARRENTY NON WARRENTY CONTRACT SERVICE CONTRACT CMC AMC

Customer Details: Pace Hospital, Miyapur, Hyd.

PARTICULARS OF INSTRUMENTS			CUSTOMER'S COMPLAINT		
Instrument :	<u>ST-200 P120</u>		<u>Air in cal B & cal A</u> State any damages before service <u>yes</u> <u>Reference Housing leakage.</u>		
Sr. No. :	<u>STP-00071</u>				
Software Version :	<u>A6.F.010</u>				
Date of Installation :	<u>25/12/2016</u>				
Pack Lot No.	Pack percentage	No. of Samples			
<u>R-20107-W</u>	<u>67%</u>	<u>20</u>			

Electrodes Lot Number					
BD	<u>DF3BD187019</u>	Na	<u>2101D03</u>	pH	<u>-</u>
Reference	<u>REF5CH2001D48</u>	K	<u>16LB12</u>	Pco2	<u>-</u>
po2/Hcl	<u>-</u>	ica	<u>2102A06</u>	Cl	<u>16KC29</u>
Glu/lac	<u>-</u>	Li	<u>-</u>	Hc03	

Specify your Diagnosis: changed reference housing (Ref 5CH2001D48) Run the Calibration And Run the Control.

Callibration Slopes				Controls / Samples			
pH	Na	<u>59.65</u>	Glu	pH	Na	<u>40.2</u>	Glu
Pco2	K	<u>56.42</u>		Pco2	K	<u>3.83</u>	
po2	iCa	<u>31.35</u>	Lac	po2	iCa	<u>1.30</u>	Lac
Hct	Cl	<u>51.41</u>		Hct	Cl	<u>102.2</u>	
Hco3	Li			Hco3	Li		

New Spares: Ref. Electrode Lot No.: Ref 5CH2001D48 Old Spares: Ref. Electrode Lot No.: Ref 16KG37

Condition after Service: Functioning normally (see Remarks)
 Functioning but requires Action (see Remarks)
 Referred to service centre (see Remarks)

Charges if any: -

Customer's Remark / Engineer's Remarks: changed reference housing

Service Engineer: [Signature] Date: 03/07/2021 Customer Signature with stamp: [Signature] 